# Information Only Service Note

Supersedes: NONE

## N5746A DC System Power Supply

Serial Numbers: Refer to Table 1

**The Problem** – Units in the above serial number range may encounter missing serial number in WebUI and Keysight Connection Expert.

Parts Required: NONE

ADMINISTRATIVE INFORMATION

[]] Calibration Required [X] Calibration NOT Required PRODUCT LINE: SP AUTHOR: LIM ZHAN MING

ADDITIONAL INFORMATION:



© Keysight Technologies 2015-2023 Information Only Service Note Version 1.3 | May 18, 2023| Page **1** of **3** 

#### Situation:

Units in the above serial number range may encounter instrument unsecure store and result in missing serial number. The serial number will show "0" in WebUI and Keysight Connection Expert as shown in Figure 1 and Figure 2 respectively.

However, there is no impact on the functionality and specification of the instrument.



Figure 1: Serial number is "0" in WebUI



Figure 2: Serial number is "0" in Keysight Connection Expert

#### Solution/Action:

How to verify:

- 1. Turn on the instrument, connect it by using any of the interfaces.
- 2. Go to WebUI and Keysight Connection Expert to verify if the serial number is "0" as shown in Figure 1 and Figure 2 respectively.
- 3. Go to "Keysight Connection Expert" > "Interactive IO" > click "SYST:ERR?".
- 4. If error 208 prompts out, it means this instrument was not "secure stored".

#### How to fix:

- 1. Click on the link: <u>Secure Store Tool</u> to download the .exe file.
- 2. Run the "SecureStoreInitialization" fix tool.
- 3. Follow the instructions stated in the program.
- 4. The program will run for approx. 45 seconds.
- 5. Reboot your instrument after the process has completed.
- 6. Send "SYST:ERR?" to verify that "no errors" are reported.
- 7. Make sure WebUI and Keysight Connection Expert are showing the serial number.

#### Table 1: Affected Serial Number

US22E5470A	US22F7887R	US23B4009R	US23D6216R
US22E5471A	US23B4006R	US23B4010R	US23D6217R
US22E5499A	US23B4007R	US23B4011R	US23D6218R
US22E5507A	US23B4008R	US23B4015R	US23D6221R

### Revision History:

Date	Service Note Revision	Author	Reason for Change
19 <sup>th</sup> May 2023	01	LIM ZHAN MING	As Published