Modification Recommended Service Note

Supersedes: NONE

N9048B PXE EMI Receiver

Serial Numbers: MY59290103, MY59290104, MY59290105, MY59290118, MY59290119, MY59290123, MY59290148, MY59500028, MY60300111, MY60450101, MY61390105, MY61390113, MY62220123, MY62220127, MY63030111, MY63072015, MY63472028, MY63472003

The Problem – Characterize Noise Floor required prompt even Characterize Noise Floor is performed.

Parts Required: NONE. Software update only

ADMINISTRATIVE INFORMATION

ACTION	[]] ON SPECIFIED FAILURE	STANDARDS	
CATEGORY:	TEGORY: [X] AGREEABLE TIME LABOR: 0.5 Hours		
LOCATION	[X] CUSTOMER INSTALLABLE (No Parts involved) [X] SERVICE CENTER	SERVICE: [[]] RETURN USED [[]] RETURN INVENTORY: [[]] SCRAP PARTS: [[]] SCRAP	
CATEGORY:	[[]] ON-SITE (active On-site contract required) [[]] CHANNEL PARTNERS	[]] SEE TEXT [[]] SEE TEXT	
AVAILABILITY	: PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: Aug 1, 2025	
	[[]] Calibration Required [X] Calibration NOT Required	PRODUCT LINE: 12 AUTHOR: YC	

ADDITIONAL INFORMATION:



Situation:

After the Characterize Noise Floor alignment is expired and Characterize Noise Floor alignment is performed, found that SystemNoiseModelDensityForTDSAlgorithm alignment is failing. This issue was fixed with XA30 but there is regression issue with firmware revision XA36, XA37 and XA38.

The issue only appears on instruments with option 503 and WF1 and with the serial numbers shown above.

Solution/Action:

Download and install instrument software A.39.00 or later. Perform the Characterize Noise Floor routine. Press System (the gear icon in the upper right portion of the instrument screen), Alignments, Advanced, Characterize Noise Floor.

Instrument software is available at:

https://www.keysight.com/find/xseries_software

Revision History:

Date	Service Note Revision	Author	Reason for Change
01 Aug 2024	01	Yin Chei, Wong	As Published