Y1155A-01

# Modification Recommended Service Note

Supersedes: NONE

# Y1155A Distribution Board with Generic Screw Terminals for Driving 16 Switch Coils

Serial Numbers: Y1155-26511 Rev 002 and below

The Problem – Solder shorts between terminals on PCA

## Parts Required:

P/N Description Qty. Y1155-66511 Distribution Board with Screw Terminals for Driving 16 Switch Coils 1

#### ADMINISTRATIVE INFORMATION

| ACTION<br>CATEGORY:   | [X] ON SPECIFIED FAILURE [[]] AGREEABLE TIME   | STANDARDS  LABOR: 0.5 Hours  |
|-----------------------|--|--|
| LOCATION<br>CATEGORY: | [[]] CUSTOMER INSTALLABLE [[]] ON-SITE (active On-site contract required) [X] SERVICE CENTER [[]] CHANNEL PARTNERS | SERVICE: [[]] RETURN USED [[]] RETURN INVENTORY: [X] SCRAP [[]] SEE TEXT [[]] SEE TEXT |
| AVAILABILITY          | : PRODUCT'S SUPPORT LIFE   | NO CHARGE AVAILABLE UNTIL: 17 March 2020   |
|                       | [[]] Calibration Required [X] Calibration NOT Required   | PRODUCT LINE: PLGM<br>AUTHOR: SL   |

ADDITIONAL INFORMATION:




### Situation:


Instrument within the serial number range may experience shorts on PCA between terminals 7 to 17, and terminals 8 to 18. This is due to the presence of solder between the via hole and the connector lead, therefore causing the connections between the faulty terminals.


## Solution/Action:

1. Verify that your unit(s) corresponds to the above model and PCB board revision number.

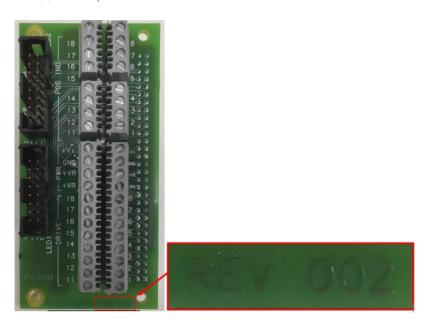

2. Perform continuity test using a multimeter at the bottom of PCA between terminals 7 to 17, and terminals 8 to 18, as shown in the figures below.

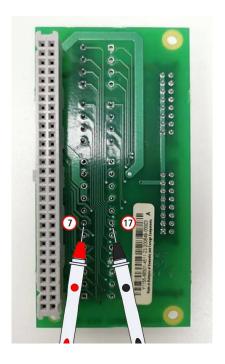

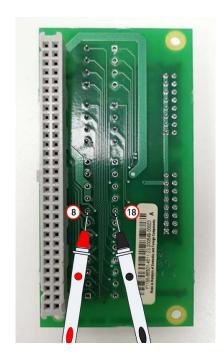

- 3. If the continuity test fails, the instrument does not require modification.
- 4. For users encountering connection between the abovementioned terminals, please contact the nearest Keysight Technologies' Customer Contact at <a href="https://www.keysight.com/find/contactus">www.keysight.com/find/contactus</a>.

### **Revision History:**

| Date          | Service<br>Note<br>Revision | Author | Reason for Change |
|---------------|-----------------------------|--------|-------------------|
| 17 March 2019 | 01                          | SL     | As Published      |
|               |                             |        |                   |