E5071B-17

SERVICE NOTE

Supersedes: NONE

E5071B - ENA Series Network Analyzer, 300 kHz to 8.5 GHz

Serial Numbers:

"JP1KK00001 to JP1KK99999, MY42100001 to MY44999999, SG42100001 to SG449999999"

"To strengthen the front USB receptacle, add USB receptacle retention plate"

Parts Required:

P/NDescriptionQty.E5062-04003Cover USB Small1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION AVAILABLE		
ACTION CATEGORY::	AGREEABLE TIME	[[]] PERFORMANCE ENHANCEMENT X SERVICE / RELIABILITY ENHANCEMENT
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER [[]] CHANNEL PARTNERS	AVAILABILITY: Until End Of Support
AUTHOR: jm		PRODUCT LINE: WN
ADDITIONAL INFORMATION:		

© AGILENT TECHNOLOGIES, INC. 2009 PRINTED IN U.S.A.




Situation:

In case the front USB receptacle (E5070-66533) becomes loose, add USB receptacle retention plate (E5062-04003) to strengthen the front USB receptacle.


Solution/Action:



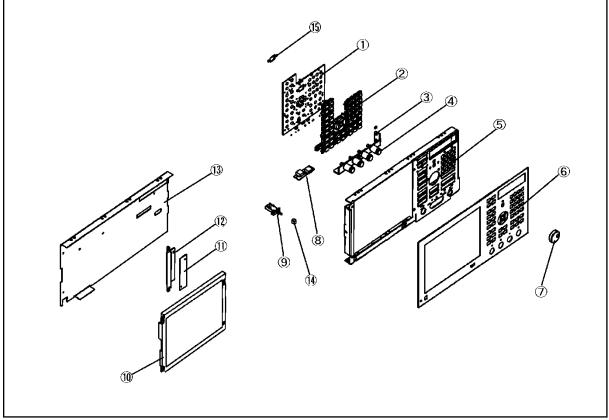

- e5070bse3007
- 1. Remove three pieces of screws. (See Reference Designator #8 of Figure 5-31 and Table 5-31 in the service manual)
- 2. Add USB receptacle retention plate.
- 3. Add the removed screws (See Reference Designator #8 of Figure 5-31 and Table 5-31 in the service manual) with 9 in-lb torque driver/T10 bit

Note: Pay attention to the direction of the USB receptacle retention plate.

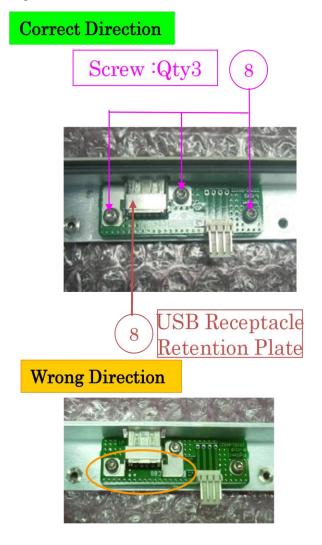

- End Of Document -