

N5772A-09

Information Only Service Note

Supersedes:
NONE

N5772A DC System Power Supply

Serial Numbers: Refer to Table 1

The Problem – Units in the above serial number range may encounter missing serial number in WebUI and Keysight Connection Expert.

Parts Required:

NONE

ADMINISTRATIVE INFORMATION

Calibration Required
 Calibration NOT Required

PRODUCT LINE: SP
AUTHOR: LIM ZHAN MING

ADDITIONAL INFORMATION:

Situation:

Units in the above serial number range may encounter instrument unsecure store and result in missing serial number. The serial number will show “0” in WebUI and Keysight Connection Expert as shown in Figure 1 and Figure 2 respectively.

However, there is no impact on the functionality and specification of the instrument.

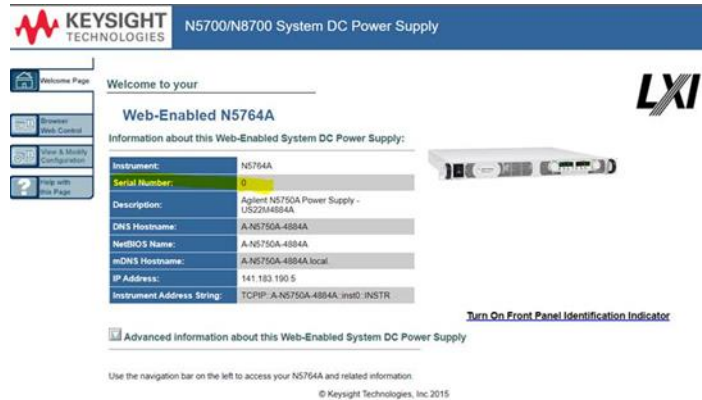


Figure 1: Serial number is “0” in WebUI

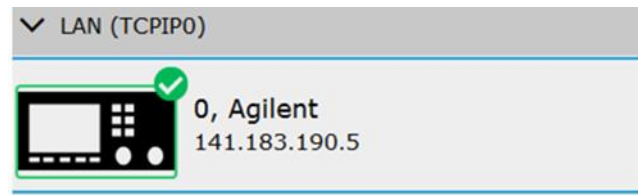


Figure 2: Serial number is “0” in Keysight Connection Expert

Solution/Action:

How to verify:

1. Turn on the instrument, connect it by using any of the interfaces.
2. Go to WebUI and Keysight Connection Expert to verify if the serial number is “0” as shown in Figure 1 and Figure 2 respectively.
3. Go to “Keysight Connection Expert” > “Interactive IO” > click “SYST:ERR?”.
4. If error 208 prompts out, it means this instrument was not “secure stored”.

How to fix:

1. Click on the link: [Secure Store Tool](#) to download the .exe file.
2. Run the “SecureStoreInitialization” fix tool.
3. Follow the instructions stated in the program.
4. The program will run for approx. 45 seconds.
5. Reboot your instrument after the process has completed.
6. Send “SYST:ERR?” to verify that “no errors” are reported.
7. Make sure WebUI and Keysight Connection Expert are showing the serial number.

Table 1: Affected Serial Number

| | | | |
|------------|------------|------------|-------------|
| US22J0498S | US22M5502S | US23B3419S | US23C4685S |
| US22M4559S | US22M5507S | US23B3420S | US23C4741S |
| US22M4944S | US22N6439S | US23B3423S | US23C5244S |
| US22M4946S | US22N6446S | US23B4090S | US23C5245S |
| US22M5495S | US23A0141S | US23B4093S | US23C5264S |
| US22M5496S | US23A0360S | US23C4344S | US23C5266S |
| US22M5498S | US23B3395S | US23C4366S | US23C5267S |
| US22M5500S | US23B3415S | US23C4681S | US23C526902 |
| US22M5501S | US23B3416S | US23C4682S | |

Revision History:

| Date | Service Note Revision | Author | Reason for Change |
|---------------------------|-----------------------|---------------|-------------------|
| 19 th May 2023 | 01 | LIM ZHAN MING | As Published |
| | | | |
| | | | |
| | | | |