

DSOX4052A-01

S E R V I C E N O T E

Supersedes:
NONE

4000 X-Series Scopes

Serial Numbers: MY000000000 / MY53260000 or SG000000000 / SG53260000

A replacement of the power supply cover is needed when the cabinet assembly is replaced.

Parts Required:

| P/N | Description | Qty. |
|-------------|--------------------|------|
| 54709-64401 | Cabinet Assembly | 1 |
| 54695-00103 | Power Supply Cover | 1 |
| 0515-0380 | Screw | 1 |

ADMINISTRATIVE INFORMATION

| | | |
|--|--|---|
| SERVICE NOTE CLASSIFICATION: | | |
| MODIFICATION RECOMMENDED | | |
| ACTION <input checked="" type="checkbox"/> ON SPECIFIED FAILURE CATEGORY: <input type="checkbox"/> AGREEABLE TIME | STANDARDS LABOR: 0.25 Hours | |
| LOCATION <input type="checkbox"/> CUSTOMER INSTALLABLE CATEGORY: <input type="checkbox"/> ON-SITE (active On-site contract required) <input checked="" type="checkbox"/> SERVICE CENTER <input type="checkbox"/> CHANNEL PARTNER | SERVICE <input checked="" type="checkbox"/> RETURN INVENTORY: <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT | USED <input checked="" type="checkbox"/> RETURN PARTS: <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT |
| AVAILABILITY: PRODUCT'S SUPPORT LIFE | NO CHARGE AVAILABLE UNTIL: 31-Aug-2014 | |
| <input type="checkbox"/> Calibration Required <input checked="" type="checkbox"/> Calibration NOT Required | PRODUCT LINE: 1A AUTHOR: DJB | |
| ADDITIONAL INFORMATION: | | |

© AGILENT TECHNOLOGIES, INC. 2013
PRINTED IN U.S.A.

September 3, 2013

Rev. 21



Situation:

If the cabinet assembly requires a replacement, also replace the power supply cover in order to become compatible with the new revision of cabinet assembly and become compatible with zipper pouch attachment.

Solution/Action:

1. If the cabinet assembly (54709-64401) needs to be replaced, check if it is the old revision or the new revision
 - a. Old revision has 3 screw holes
 - b. New revision has 4 screw holes




Old revision cabinet




New revision cabinet

2. If the cabinet assembly is the new revision, proceed with repair as normal
3. If the cabinet assembly is the old revision
 - a. Replace the power supply cover (54695-00103) with new revision
 - b. Replace cabinet assembly as usual (54709-64401)
 - c. Insert screw (0515-0380) into the new screw hole on the cabinet assembly (circled below)

Power Supply Cover 54695-00103

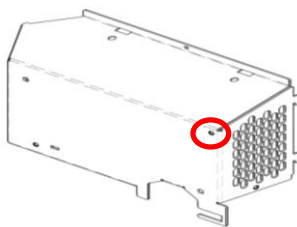

New revision cabinet assembly (54709-64401)

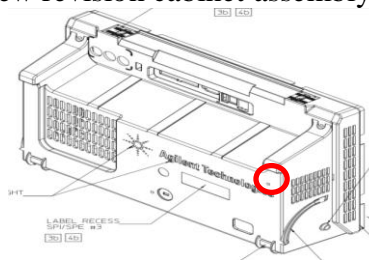

Revision History:

| Revision Number | Date | Author | Reason For Change |
|-----------------|-------------|------------------|-------------------|
| 1.0 | 25-Jul-2013 | Daniel Bogdanoff | As published |
| | | | |