U1185A-01

Modification Recommended Service Note

Supersedes: NONE

U1185A Thermocouple (J-type) and Temperature Probe Adapter

Serial Numbers: ALL

The Problem – U1185A J-type thermocouple and temperature probe adapter set could have a faulty temperature probe adapter.

Parts Required:

P/N	Description	Qty.
U1184-64101	Temperature Probe Adapter	1

ADMINISTRATIVE INFORMATION

ACTION CATEGORY:	[X] ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS LABOR: 0.25 Hours		
LOCATION CATEGORY:	[]] CUSTOMER INSTALLABLE []] ON-SITE (active On-site contract required) [X] SERVICE CENTER []] CHANNEL PARTNERS	SERVICE: [[]] RETURN USED [[]] RETURN INVENTORY: [[]] SCRAP PARTS: [X] SCRAP [X] SEE TEXT [[]] SEE TEXT		
AVAILABILITY	: PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 25 June 2021		
	[]] Calibration Required[X] Calibration NOT Required	PRODUCT LINE: GM AUTHOR: WY		

ADDITIONAL INFORMATION:



Situation:

The U1185A J-type thermocouple and temperature probe adapter set purchased in Dec 2019 to May 2020 could have a faulty temperature probe adapter (U1184A).


A faulty temperature probe adapter will cause meter to show "OL" when the temperature probe adapter with a probe is plugged into the input jacks of a handheld meter.

Users will not be able to perform temperature measurement when using this faulty temperature probe adapter.

Solution/Action:

Perform the steps below to verify your temperature probe adapter:

- 1. Select temperature measurement on your handheld meter.
- 2. Insert the temperature probe adapter with a probe into the input jacks of the meter.

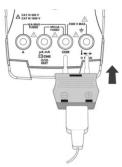

- 3. When a faulty temperature probe adapter is plugged in, your meter will show "OL" (open thermocouple).
- 4. Certain meters might not show "OL" when a faulty temperature probe adapter is plugged in. For this case, verify the temperature probe adapter with a known temperature.
- 5. If the temperature probe adapter is verified faulty, kindly contact Keysight Customer Contact Center at <u>www.keysight.com/find/contactus</u> to return the temperature probe adapter and get a new replacement part.

Revision History				
Date	Service Note Revisior	Author	Reason for Change	
25 June 2020	01	WY	As Published	