

INFORMATION ONLY – DOES NOT COMMUNICATE
A MODIFICATION OR SAFETY CONDITION

4352B-11

S E R V I C E N O T E

Supersedes:
[None]

Agilent 4352B VCO/PLL Signal Analyzer

Serial Numbers: See Solution / Action

Part Number Changes for Power Supply Switch Parts

Parts Required: See Solution / Action

To Be Performed By: Agilent-Qualified Personnel

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:	
INFORMATION ONLY	
AUTHOR: TO	PRODUCT LINE: WN
ADDITIONAL INFORMATION:	

© AGILENT TECHNOLOGIES, INC. 2002
PRINTED IN U.S.A.

September 18, 2002



Situation:

The power switch holder (P/N 04396-01274) and the power switch assembly (P/N 04396-61701) for the 4352B were obsoleted and replaced with new parts. Additionally, a new rod (P/N 04194-40001), which is inserted between the switch and LINE push-button, is set up.

Solution/Action:

When replacing the switch holder or the switch assembly, order appropriate parts depending on the serial number of the 4352B.

Serial Number: JP2KE00902 and below

When either the switch holder (P/N 04396-01274) or the switch assembly (P/N 04396-61701) is faulty, replace all the parts listed in Table 1 with the new parts shown in Table 2. Insert the rod (P/N 04194-40001) between the power switch and LINE push-button as shown in Figure 1.

Serial Number: JP2KE00903 and above

New switch holder and switch assembly are used in the 4352B. When replacing the switch assembly, holder or rod, use the replacement parts listed in Table 2

Table 1 Old Parts (obsoleted)

Part Number	Qty.	Description
04396-01274	1	Switch Holder
04396-61701	1	Switch Assembly
0515-0868	2	Screw fixing 04396-01274 on the chassis

Table 2 New Replacement Parts

Part Number	Qty.	CPL Description
04396-01276	1	Switch Holder
04396-61702	1	Switch Assembly
04194-40001	1	Rod for 04396-61702
0515-1719	2	Screw fixing 04396-01276 on the chassis

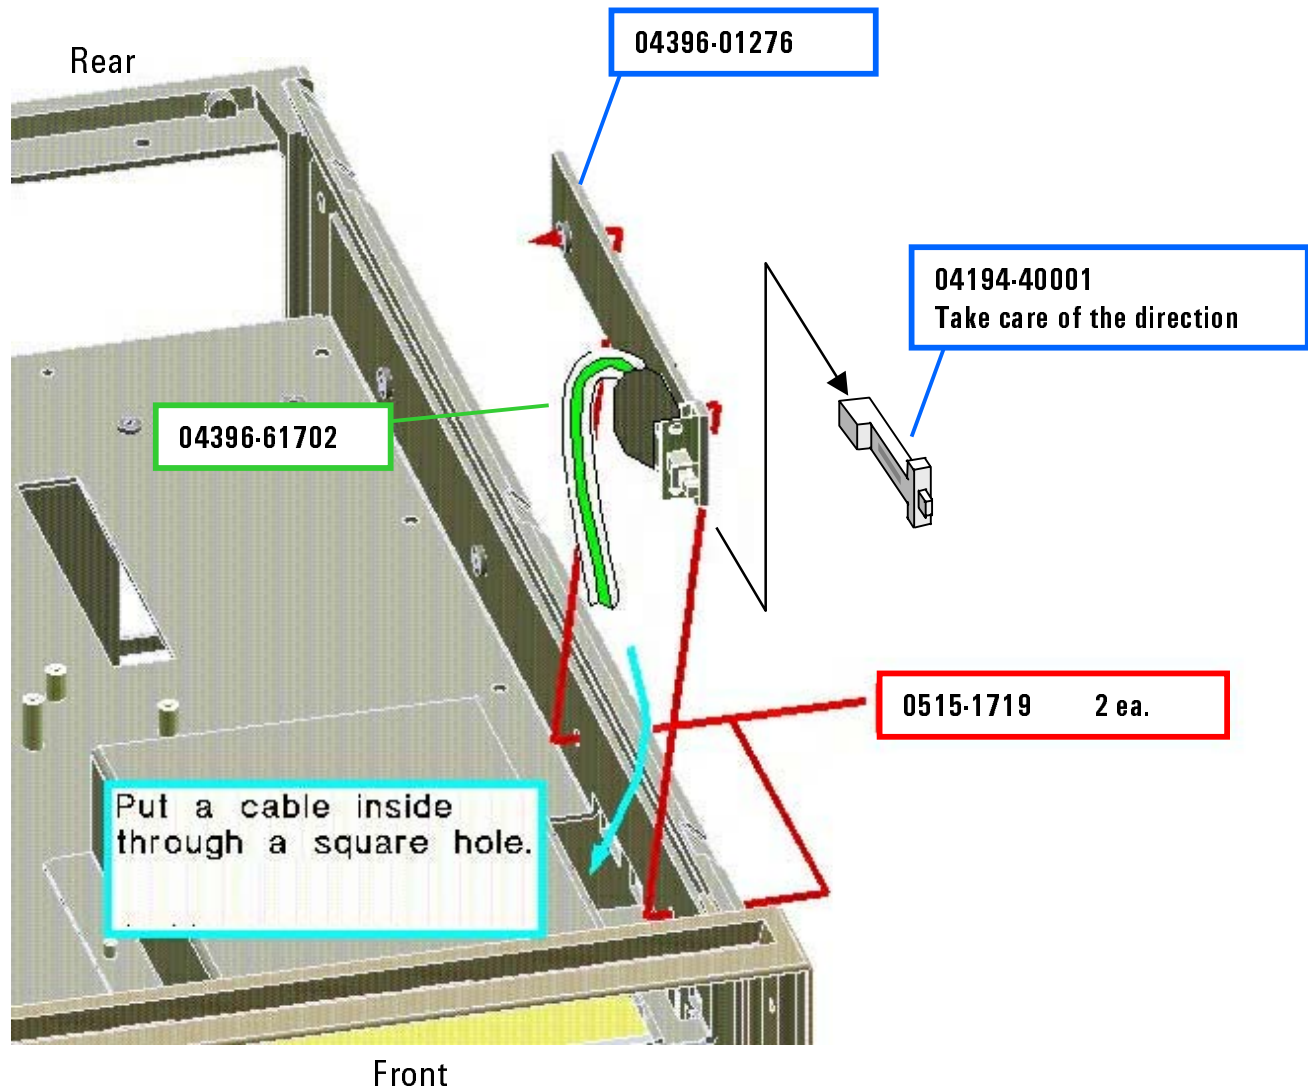


Figure 1 Replaceable Parts from Bottom View