E4416A-13A

<u>SERVICE NOTE</u>

Supersedes: E4416A-13

EPN	/ [_]	РΡ	ower	M	leter
	, ,			_ X _ X _ J	

Serial Numbers: ALL

Compatibility between front panel assembly and processor assembly.

Parts Required:

P/N Description Qty.

NONE

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
INFORMATION ONLY					
AUTHOR: CH	PRODUCT LINE: WC				
ADDITIONAL INFORMATION:					

© AGILENT TECHNOLOGIES, INC. 2009 PRINTED IN U.S.A.



March 4, 2009

Rev. 16

Page 2 of 5 E4416A-13A

Situation:

Agilent Technologies is changing the design of its EPM-P power meter's front panel assembly due to the obsolescence of LCD's IC controller resides inside the front panel assembly. This new version of front panel assembly is incompatible with the old version of processor assembly. The performance and functions of the power meter remain the same. The replacement and calibration procedures remain the same as well. Please refer below for the part numbers to be ordered.

Description	Part Number With Old Design	Part Number With New Design
Processor Assembly	E4416-60006	E4416-66001
Front Panel Sub-assembly	E4416-61009	E4416-61024
Front Panel Assembly for: Agilent E4416A and Agilent E4416A Option 002	E4416-61002	E4416-60201
Front Panel Assembly for: Agilent E4416A Option 003	E4416-61012	E4416-60202

Solution/Action:

When replacing any of the assemblies, it is important to ensure that both assemblies are compatible with each other in order to function properly. It is a must to have the revision for both front panel assembly and processor assembly checked before and after the replacement. The compatibility table is as shown below.

	Old version of front panel assembly	New version of front panel assembly
Old version of processor assembly	Compatible	Incompatible
New version of processor assembly	Compatible	Compatible


The revision of the front panel assembly and processor assembly can be differentiated based on instructions below.

Page 3 of 5 E4416A-13A

Processor Assembly

The new processor assembly can be differentiated through U7 and U8 on the assembly.


1. Zoom to location U7 and U8 of the processor assembly.

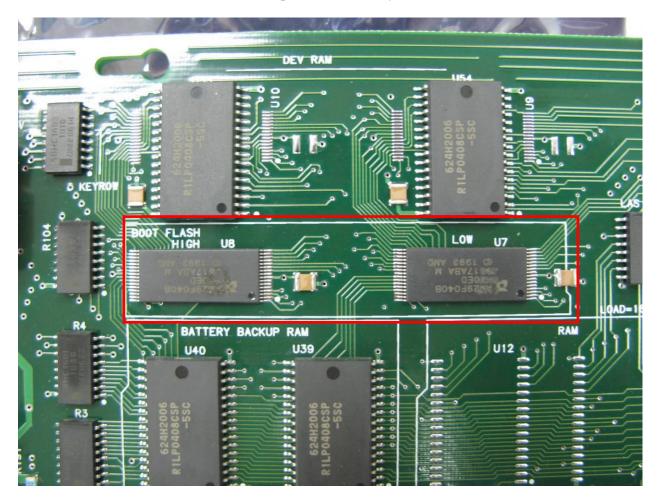

2. Verify that the 5X5 part number on the flash IC is E4416-80003 and E4416-80004 for U7 and U8 respectively. The old 5X5 part number is E4416-80001 and E4416-80002 for U7 and U8 respectively.


Page 4 of 5 E4416A-13A

Front Panel Assembly/Sub-assembly (for standard option, option 002 and option 003) The new front panel assembly can be differentiated through some components as illustrated below.

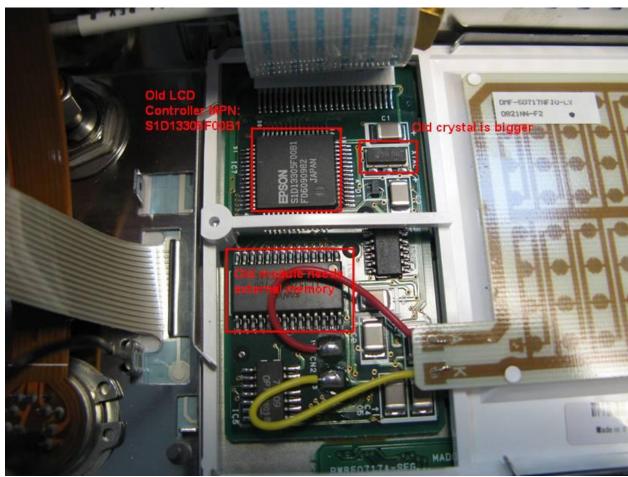

Old Front Panel Assembly

Page 5 of 5 E4416A-13A

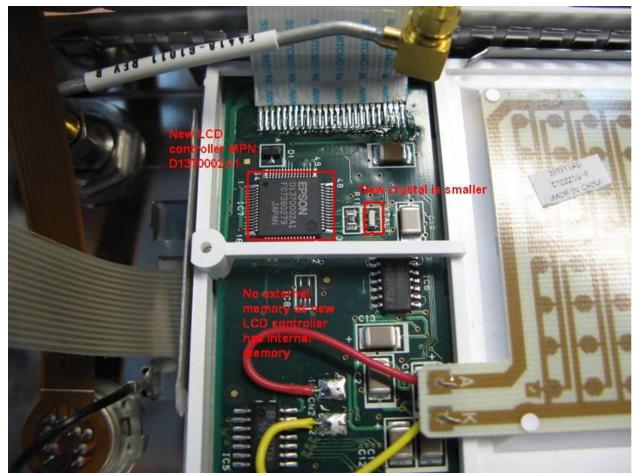

New Front Panel Assembly