<u>SERVICE NOTE</u>

Supersedes: NONE

6625A-11

6625A DC Power Supply

Serial Numbers: MY41000101 - MY41000178 / SG41000174

Intermittent Power Transformer "Magmate" Connections

To Be Performed By: Agilent-Qualified Personnel or Customer

Model No.	Part Number	Description	Qty. 1
6621A	9100-4645	Power Transformer	
6622A	9100-4490	Power Transformer	1
6623A	9100-4646	Power Transformer	1
6624A	9100-4561	Power Transformer	1
6625A	9100-4720	Power Transformer	1
6626A	9100-4591	Power Transformer	1
6627A	9100-4592	Power Transformer	1
6628A	9100-4720	Power Transformer	1
6629A	9100-4591	Power Transformer	1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:								
MODIFICATION RECOMMENDED								
ACTION CATEGORY:	X IMMEDIATELY [[]] ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS: LABOR: 01 Hours						
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER	SERVICE INVENTORY:	X RETURN SCRAP [[]] SEE TEXT	USED PARTS:	[[]] RETURN X SCRAP [[]] SEE			
TEXT AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESI	SEE TEXT PONSIBLE UNTIL:	Support Li	SEE TEXT fe of Product			
AUTHOR: RJM ADDITIONAL INFORM	PRODUCT LINE: 33 MATION:							
© AGILENT TECHI	NOLOGIES, INC. 2002							

PRINTED IN U.S.A.





Situation:


The power transformer vendor mistakenly installed the wrong "Magmates" in a run of power transformers. The incorrect "Magmates" have a # 43 stamped on them, which corresponds to a 15 gauge wire size. The correct size "Magmate" should be # 24 designed for a 19 gauge wire size.

This could result in a variety of intermittent as well as steady hardware problems and errors. Examples: HDW ERR CH 1, Blank front panel display, not meeting specifications.

Solution/Action:

Replace the Power Transformer with a new replacement Transformer, see the table above for the correct power transformer part number.

NOTE: Please inspect the new transformer for the correct "Magmate" number stamping.

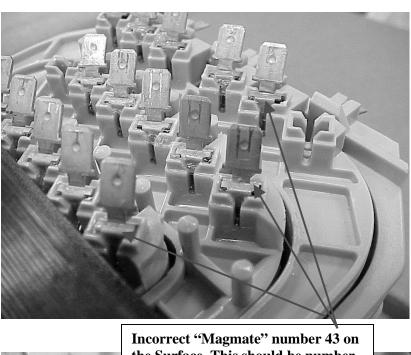

Top View of Power Transformer:

